



Automatic Snow and Ice Sensor
(A9013052)

Uponor

RADIANT HEATING AND
COOLING SYSTEMS

**AUTOMATIC SNOW
AND ICE SENSOR**

TECHNICAL BULLETIN

Automatic Snow and Ice Sensor 12" Lead Wire

Affected Product

Automatic Snow and Ice Sensor (A9013052) used with the Climate Cöntrol™ Network System and the Climate Cöntrol Multifunction Controller

Symptom

Sensor shorts out, providing a high-temperature reading and preventing a snow melt call.

Issue

The 12" lead wire on the original sensor was too short, requiring a connection in the non-waterproof cup. When the cup fills with water, it shorts the connection, providing a high-temperature reading. This condition can lead to communication issues for both the Climate Cöntrol Network System and the Climate Cöntrol Multifunction Controller.


Resolution

Uponor changed the 12" leads to 60'.

Corrective Action

Return the Automatic Snow and Ice Sensor for warranty through Uponor's RMA (return materials authorization) process. Note that incomplete returns (missing parts, temporary cover, etc.) or products returned damaged from misuse will be refused.

Contact your local Uponor representative or distributor for further information.

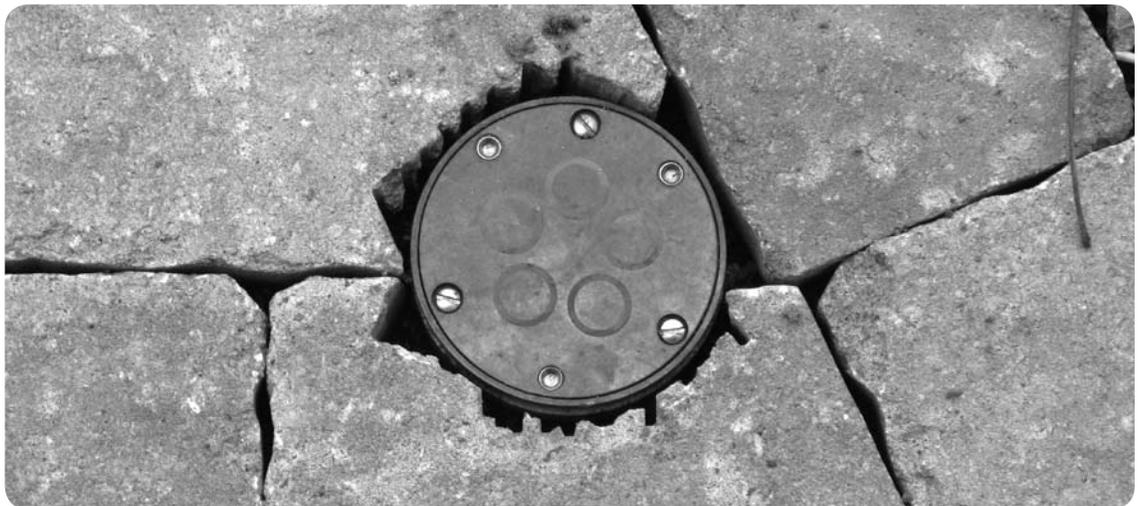

Uponor, Inc.
5925 148th Street West
Apple Valley, MN 55124 USA
Tel: 800.321.4739
Fax: 952.891.2008
Web: www.uponor-usa.com

Uponor Ltd.
2000 Argenta Rd., Plaza 1, Ste. 200
Mississauga, ON L5N 1W1 CANADA
Tel: 888.994.7726
Fax: 800.638.9517
Web: www.uponor.ca